

Subject: SQUEAK, CHATTER OR RATTLE NOISE FROM FRONT SEAT BELT BUCKLE	Bulletin No: 08-003/09
	Last Issued: 10/23/2009

BULLETIN NOTE

- This bulletin supersedes the previous bulletin 08-003/09 issued 05/15/09 and 05/22/09. The SUBJECT, APPLICABLE MODEL(S) / VINS and DECSRIPTION have been revised.
- Changes are noted below in Red beside the change bar.

APPLICABLE MODEL(S) / VINS


2006-2010 MX-5

2006-2010 MAZDA5

2007-2010 CX-9

DESCRIPTION

A squeak, chatter and/or rattle noise may come from the driver side seat while driving on slightly uneven road surfaces. Due to assembly variation, the bolt and washer may come in contact with each other causing the noise.

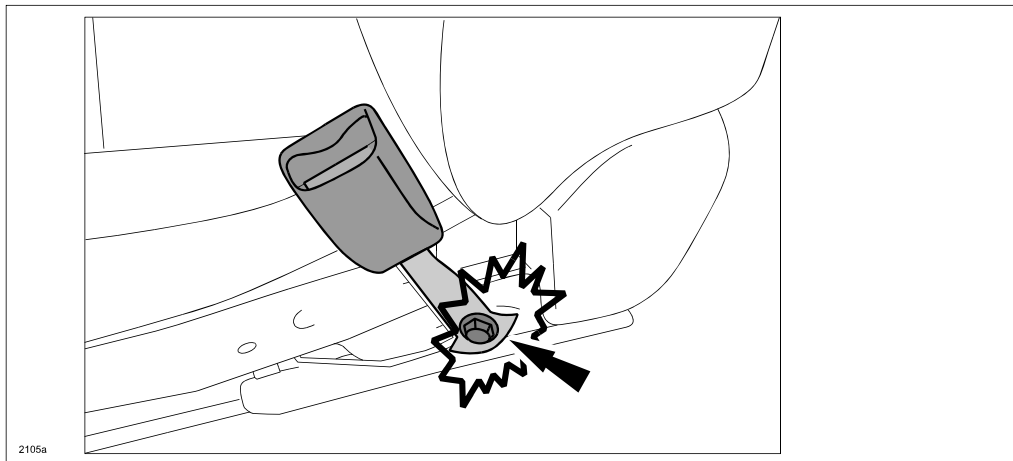


The diameter of the bolt flange has been increased during mass-production.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE


1. Verify the customer concern by moving the buckle left and right.
 - If the noise is heard, replace the bolt (A) with a new one.
Tightening Torque: 28.2 - 57.8 ft. lbf. (38.2 - 78.4 Nm, 3.9 - 7.99 kgf.-m)
 - If the noise is not heard, refer to the Workshop Manual for further diagnostics.

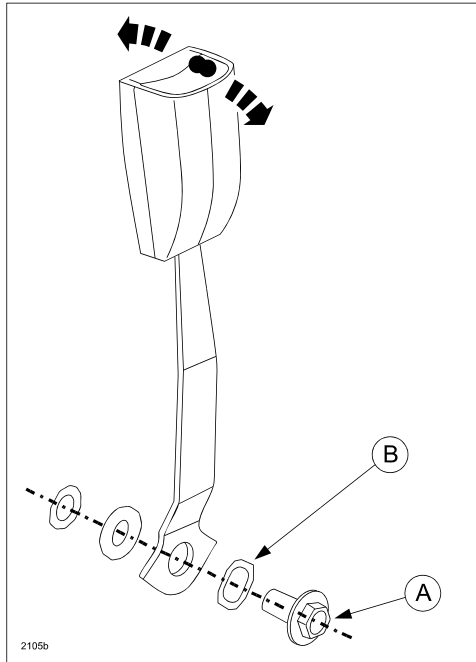


NOTE: Ensure wave washer (B) is installed.

If an urgent repair is necessary and the bolt is not available, repair using the following procedure.

1. From Noise Repair Kit, peel off a 5mm strip pad (A).

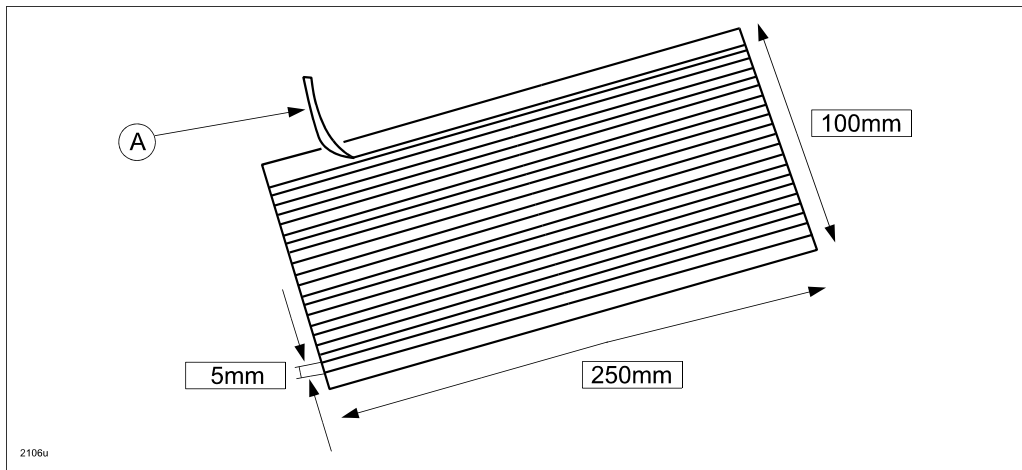

2. Wrap strip pads around wave washer (B) at five (5) locations; cut off any surplus.

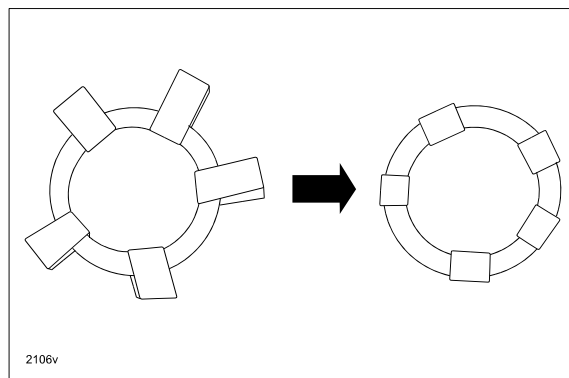

3. Reinstall removed parts.

NOTE:

- Do not apply any grease.
- Ensure the buckle can move properly.

PART(S) INFORMATION

Model	Part Number	Description	Qty.	Notes
MX-5 / Mazda5	L528-57-811	Bolt	1	One Seat
CX-9	TD11-57-811	Bolt	1	One Seat
---	K001-W0-225	Noise Repair Kit	1	---

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

	Mazda5	MX-5
Warranty Type	A	A
Symptom Code	82	82
Damage Code	9B	9B
Part Number Main Cause	L528-57-811	L528-57-811
Quantity	1, 2 or 0	1, 2 or 0
Operation Number / Labor Hours:	XXE01XRX / 0.4 Hrs. (One side) XXE01ARX / 0.6 Hrs. (Both sides)	XXE01XRX / 0.3 Hrs. (One side) XXE01ARX / 0.4 Hrs. (Both sides)

	CX-9
Warranty Type	A
Symptom Code	82
Damage Code	9B
Part Number Main Cause	TD11-57-811
Quantity	1, 2 or 0
Operation Number / Labor Hours:	XXE01XRX / 0.4 Hrs. (One side) XXE01ARX / 0.6 Hrs. (Both sides)